# Melec



**5-phase Stepping Motor Driver** 

# GDB-5KS40 Instructions Manual (For designers' use)



Please ensure to read and understand this Instructions Manual before using the product. Please keep this Instructions Manual at hand so that it is always available for reference.



#### Introduction

This Instructions Manual describes the safe and proper method of handing "5-phase Stepping Motor Driver GDB-5KS40" with emphasis on the specifications, assuming that our readers are engaged in designing of control devices incorporating stepping motors.

Please ensure to read and understand this Instructions Manual before using the product.

Please keep this Instructions Manual at hand so that it is always available for reference.

#### Descriptions in this manual on safety matters:

This product must be operated and used properly.

Otherwise, or when it is operated and used erroneously, unforeseen accidents may occur, causing physical injuries or property damages.

Majority of these accidents can be avoided if you are well informed of hazardous circumstances in advance.

Consequently, this instructions manual describes all the hazardous and dangerous circumstances and situations which can be foreseen and anticipated as well as necessary precautions.

All the above descriptions are being titled by the following symbol-marks and signal-words, namely:

♠ WARNING

Represents warnings ignorance of which can cause accidents involving fatal or serious physical injuries.

⚠ CAUTION

Represents cautions ignorance of which can cause accidents involving minor physical injuries or property damages.

#### Introduction

### Descriptions in this manual on safety matters:

		CONTENTS	PAGE
1.	S	afety	
	1-1. 1-2.	Safety precautionsSafety Information for Handling	6
2 .	0	verview	
	2-2.	Characteristics	10
3.	N	ame and Function of Each Section	
	3-2. 3-3. 3-4.	Signal I/O Connector (J1)	12 12 12
4 .	S	etting	
	4-2. 4-3. 4-4. 4-5. 4-6. 4-7.	Setting MOTOR SELECT switch  Setting STEP TABLE switch and STEP ANGLE SELECT switch  Setting HOLD CURRENT SELECT switch  Setting DRIVE CURRENT SELECT switch  Setting PULSE INPUT TYPE SELECT switch  Setting HOLD SWITCHING TIME SELECT switch  Setting ROTATE MODE SELECT switch  Setting EXTEND FUNCTION SELECT switch	16 17 18 19 20 21
5.	I	nstallation	
		Conditions for Installation Mounting Method	
6.	C	onnection	
	6-2. 6-3.	Overview of Connection Configuration	26 27
7.	C	onfirmation of Setting and Connection	
	7–1.	Check Points	30

# GDB-5KS40 Instructions Manual

	Q Maintanana and Chaak un	PAGE
	8. Maintenance and Check-up	
	8-1. Maintenance and Check-up8-2. Troubleshooting	
	9. Storing and Disposal	
	9-1. Storing	34
	9-2. Disposal	34
1	O. Specifications  10-1. General Specifications 10-2. I/O Signal	35
	(1) Example Circuit Connection	36
	(2) Drive pulse input (CW, CCW)	
	(3) Motor excitation stop input (M.F) ·····	38
	(4) Phase signal output (P. 0) ······	
	(5) Overheat alarm signal output and overheat alarm LED (0. H. A)	
	(6) Step angle switch input (C.S)	
	10-3. Dimensions	72
	10-4. Applicable Motors	
	10-5. Torque Characteristics	
	10-6. Conforming to Europe standards	52

The main parts which revised by this manual

#### 1. Safety

#### 1 - 1. Safety Precautions

#### **№** WARNING

- (1) This product is not designed or manufactured for application for equipment requiring high level of reliability such as equipment related to nuclear energy, aeronautics-related equipment, automobiles, ships, medical appliances directly handling the human body and equipment that might seriously affect properties.
- (2) Do not use or keep the product in explosive or corrosive environments, in the presence of flammable gases, locations subjected to splashing water, fine particles, soot, steam, or exposed to radiation or direct sunshine. Doing so may cause injury or fire.
- (3) For the driver's power supply, use a DC power supply with reinforced insulation on its primary and secondary sides.

  Failure to do so may cause electric shock.
- (4) This product is designed for use within machinery, so it should be installed within an enclosure. Failure to do so may cause injury.
- (5) Do not transport, move, install the product, perform connections or inspections when the power is on. Doing so may cause electric shock, injury or fire.
- (6) Only qualified personnel are allowed to transport, move, install the product, perform connections or inspections.
  Failure to do so may cause injury or fire.

#### ⚠ CAUTION

- (7) Do not touch the driver during operation or immediately after stopping. Doing so may cause burn on the skin due to overheating of the driver.
- (8) Ensure to use this product according to the method specified in the Instructions Manual and within the specifications.
- (9) Depending on the operational conditions, the stepping motor may step out when it is on holding-state or driving-state. In particular, the load in transport may fall if the motor steps out on the vertical drive (such as the Z-axis). Start operation after test run for deliberate confirmation of operation.
- (10) Provide fail-safe measures so that the entire system may operate in a safe mode even in cases of the external power supply failure, disconnection of the signal line, or any failure on the driver.

#### 1-2. Safety Information for Handling

#### ●0verall:

#### ♠ CAUTION

Do not touch the driver during operation or immediately after stopping. it may cause burn on the skin due to overheating of the driver.

●When setting up the MOTOR SELECT switch:

#### ⚠ CAUTION

Erroneous setting may cause burn on the skin due to overheating of the motor. Ensure correct setting.

●When setting up the STEP ANGLE SELECT switch:

#### ⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of the motor.

Ensure correct setting.

●When setting up the HOLD CURRENT SELECT switch:

#### ⚠ CAUTION

A high setting value may cause burn on the skin due to overheating of the motor. Do not select a high value beyond the required.

●When setting up the DRIVE CURRENT SELECT switch:

#### ⚠ CAUTION

A high setting value may cause burn on the skin due to overheating of the motor. Do not select a high value beyond the required.

●When setting up the PULSE INPUT TYPE SELECT switch:

⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of the motor.

Ensure correct setting.

●When setting up the ROTATE MODE SELECT switch:

⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of the motor.

Ensure correct setting.

●When setting up the EXTEND FUNCTION SELECT switch:

⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of the motor.

Ensure correct setting.

•When installing:

**⚠** WARNING

Overheating may cause fire.

Mount it on a noncombustible member.

Keep it away from combustibles.

●When connecting the DC Input/ Motor Output Connectors (J2, J3)

♠ CAUTION

Erroneous connection may cause breakage of the motor or the driver. Correctly connect the DC Input/Motor output connector.

When inputting power:

#### ♠ CAUTION

Breakage of the machine or injury is apprehended due to unexpected behavior of the motor. Maintain the state where emergency stop is enabled at any time.

●When inputting the motor excitation stop (M.F) signal:

#### ⚠ CAUTION

Deterioration of the holding power with the motor may cause breakage of the machine or injury.

Check safety before inputting.

●When the overheat alarm (O.H.A) signal is output:

#### ♠ WARNING

Overheating may cause fire.

Stop operation upon output of this signal.

●When the overheat alarm (0. H. A) LED comes on:

#### ⚠ WARNING

Overheating may cause fire.

Stop operation when this LED comes on.

•When performing maintenance and checking:

#### ♠ WARNING

Injury or fire is apprehended due to unexpected behavior.

Do not replace fuse.

Do not disassemble, repair or modify.

#### 2. Overview

#### 2-1. Characteristics

GDB-5KS40 is a driver for a 5-phase stepping motor with DC +24V input. It can drive a 5-phase stepping motor with 0.35A/phase~1.4A/phase. Step angles can be selected from eighteen step angles ranging from 1 division to 8000 division of the basic angle. HOLD CURRENT and DRIVE CURRENT can be set up.


■ Applicable motors and setting for each motor are given in the table "10-4. Applicable Motors".

#### 2-2. Product Configuration

● GDB-5KS40 One unit


J1, J2, J3 of the housing and the contact is not in accessories.

#### 2-3. Appearance

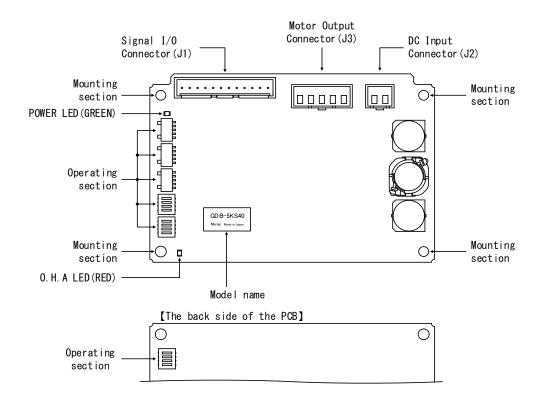


#### 3. Name and Function of Each Section

3-1. Signal I/O Connector (J 1)

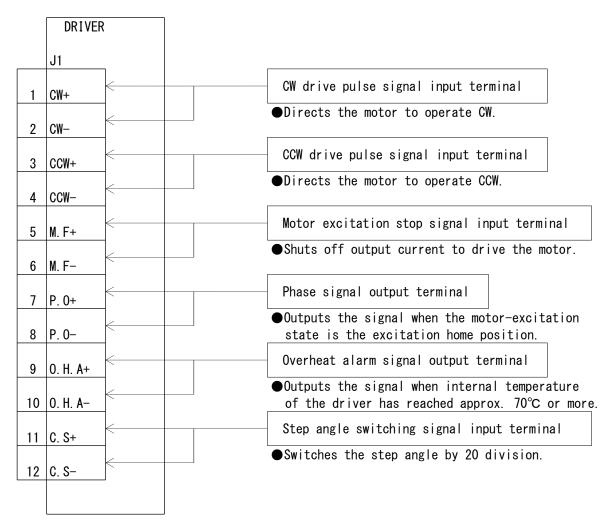

#### 3-2. DC Input/Motor Output Connector (J 2, J 3)

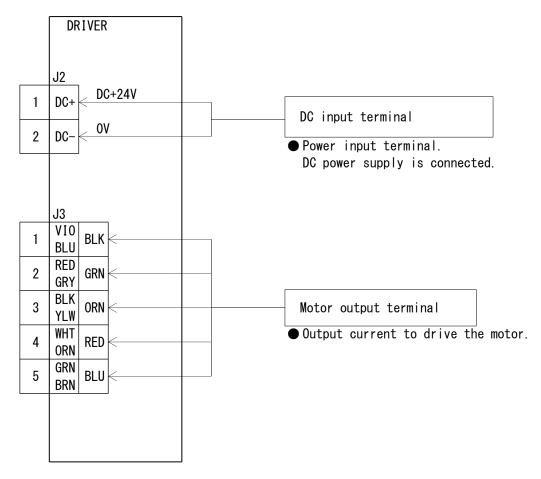


#### 3-3. POWER LED

POWER LED (GREEN) comes on upon inputting power.


#### 3 - 4. 0. H. A LED

0. H. A LED (RED) comes on when internal temperature of the driver has reached approx.  $70^{\circ}$ C or more.

#### 3-5. Operating Section

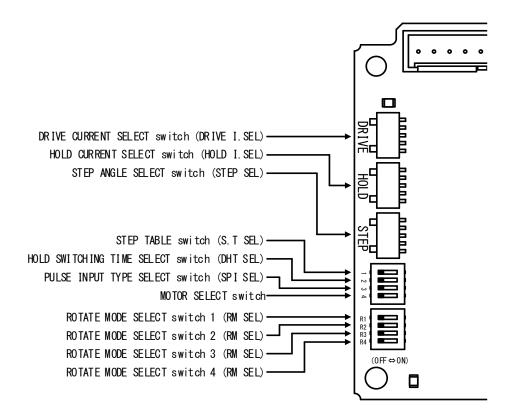

N	lame of Operating Section	Function	Factory Setting
DR	IVE CURRENT SELECT switch	Select DRIVE CURRENT.	(No.F)
НО	LD CURRENT SELECT switch	Select HOLD CURRENT.	(No. 8)
STEP ANGLE SELECT switch		Select a step angle.	(No. 1)
1	STEP TABLE switch	Select STEP TABLE.	1: [0FF(S. T1)]
2	HOLD SWITCHING TIME SELECT switch	DRIVE/HOLD CURRENT automatic switching time is selected.	2: [OFF(150ms)]
3	PULSE INPUT TYPE SELECT switch	Select a pulse input type.	3: [0FF(2P)]
4	MOTOR SELECT switch	Use it with OFF.	4: (0FF)
1	ROTATE MODE SELECT switch 1	Select ROTATE MODE.	R1: (0FF)
2	ROTATE MODE SELECT switch 2	Select ROTATE MODE.	R2: (0FF)
3	ROTATE MODE SELECT switch 3	Select ROTATE MODE.	R3: (OFF)
4 ROTATE MODE SELECT switch 4		Select ROTATE MODE.	R4: (0FF)

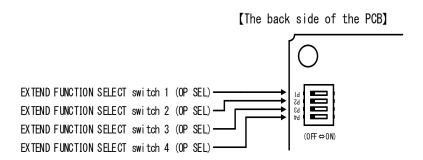

	Name of Operating Section	Function	Factory Setting
1	EXTEND FUNCTION SELECT switch 1	Select EXTEND FUNCTION	P1: (0FF)
2	EXTEND FUNCTION SELECT switch 2	Select EXTEND FUNCTION	P2: (0FF)
3	EXTEND FUNCTION SELECT switch 3	Select EXTEND FUNCTION	P3: (0FF)
4	EXTEND FUNCTION SELECT switch 4	Select EXTEND FUNCTION	P4: (0FF)

#### 4. Setting

4-1. Setting MOTOR SELECT switch

⚠ CAUTION

Erroneous setting may cause burn on the skin due to overheating of the motor.

Ensure correct setting.

Set this switch with power OFF.

(1) Use it with [OFF].

#### 4-2. Setting STEP TABLE switch and STEP ANGLE SELECT switch

⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of motor.

Ensure correct setting.

The step angle is set up with the S.T SEL switch and the STEP SEL switch.

The step angle can be selected from eighteen different types of step angles.

Set S. T SEL switch with power OFF.

- (1) Turn power [OFF].
- (2) Set the step angle required by combining the S.T SEL switch and the STEP SEL switch No.
  - ◆Relationship between the S.T SEL switch, the STEP SEL switch No. and the step angle.

S.T SEL switch (OFF: S.T1)					
STEP SEL No.	1/	step angle(°)			
SILF SLL NO.	Divisions	0.72° motor			
0	1/1	0. 72			
1	1/2	0.36 (Factory setting)			
2	1/4	0. 18			
3	1/8	0. 09			
4	1/10	0. 072			
5	1/20	0. 036			
6	1/40	0. 018			
7	1/80	0. 009			
8	1/100	0. 0072			
9	1/200	0. 0036			
Α	1/400	0. 0018			
В	1/800	0. 0009			
С	1/1000	0. 00072			
D	1/2000	0. 00036			
E	1/4000	0. 00018			
F	1/8000	0. 00009			

S.T SEL switch (ON: S.T2)					
STEP SEL No.	1/	step angle(°)			
STEP SEE NO.	Divisions	0.72° motor			
0	1/1	0. 72			
1	1/2	0. 36			
2	1/4	0. 18			
3	1/8	0.09			
4	1/10	0. 072			
5	1/20	0. 036			
6	1/40	0. 018			
7	1/80	0.009			
8	1/100	0. 0072			
9	1/200	0.0036			
Α	1/400	0. 0018			
В	1/800	0. 0009			
С	1/1000	0. 00072			
D	1/2000	0. 00036			
E	1/16	0. 045			
F	1/160	0. 0045			

- •Drive with two types of step angles are provided by combining the C.S signal.
- •When the step angle is switched from the setting of 1000, 2000, 4000 or 8000 divisions to other number of divisions (1∼800), change of the excitation position may be caused.

#### 4-3. Setting HOLD CURRENT SELECT switch

⚠ CAUTION

A high setting value may cause burn on the skin due to overheating of the motor. Do not select a high value beyond the required.

HOLD CURRENT is set up with the HOLD I. SEL switch. The ratio of HOLD CURRENT to DRIVE CURRENT can be selected.

- (1) Set the HOLD I. SEL switch No. to the ratio of HOLD CURRENT to DRIVE CURRENT required.
  - Ratio of HOLD CURRENT.

Ratio of HOLD CURRENT (%) =  $\frac{\text{HOLD CURRENT}}{\text{DRIVE CURRENT}} \times 100$ 

DRIVE I. SEL [No. 0~No. F]				
HOLD I. SEL No.	Ratio of HOLD CURRENT(%)			
0	0			
1	5			
2	10			
3	15			
4	20			
5	25 30 35			
6				
7				
8	40 45			
9				
Α	50			
В	60			
С	70			
D	80			
E	90			
F	100			

(Factory setting)

- HOLD CURRENT changes relative to DRIVE CURRENT setting.

  The ratio of HOLD CURRENT [100%] represents the same as the setting for DRIVE CURRE
- ■The greater the ratio of HOLD CURRENT grows, the more heat the motor generates when is on holding-state.

#### 4-4. Setting DRIVE CURRENT SELECT switch

#### ⚠ CAUTION

A high setting value may cause burn on the skin due to overheating of the motor. Do not select a high value beyond the required.

DRIVE CURRENT is set up with the DRIVE I.SEL switch.

- (1) Set the switch No. to the setting specified in the table "10-4. Applicable Motors."
  - •Relationship between the DRIVE I. SEL switch No. and DRIVE CURRENT.

DRIVE I. SEL No.	A/phase
0	0. 30
1	0. 325
2	0. 35
3	0. 50
4	0. 55
5	0. 60
6	0. 65
7	0. 70
8	0. 75
9	0. 80
Α	0. 90
В	1. 00
С	1. 10
D	1. 20
E	1. 30
F	1. 40

(Factory setting)

#### 4-5. Setting PULSE INPUT TYPE SELECT switch

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of the motor.
Ensure correct setting.


Pulse input method is set up with the SPI SEL switch. Set this switch with power OFF.

- (1) Turn power [OFF].
- (2) Set the SPI SEL [2P/1P] switch.

SPI SEL	Input type
ON	1 PULSE (1P)
0FF	2 PULSE (2P)

(Factory setting)

- When the motor is operated with two pulse signal inputs of CW and CCW, set the SPI SEL switch to [OFF(2P)].
- When the motor is operated with the pulse signal and direction signal input, set the SPI SEL switch to [ON(1P)].
- In the case that 1-pulse input method is selected, the CCW terminal becomes direction signal input designating the direction of the motor rotation. Drive pulse set to the CW terminal (CW+, CW-).

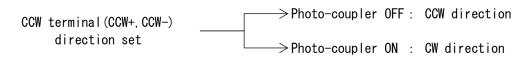

The input timing is same with 2-pulse input method and 1-pulse input method. As for input timing, refer to "10-2. (2) Drive pulse input (CW, CCW)"

#### 4-6. Setting HOLD SWITCHING TIME SELECT switch

 $\ensuremath{\mathsf{DRIVE}}/$  HOLD CURRENT automatic switching time is set up with the DHT SEL switch.

#### (1) Set the DHT SEL switch.

DHT SEL	DRIVE/ HOLD Switching Time
ON	16ms
0FF	150ms

(Factory setting)

#### 4-7. Setting ROTATE MODE SELECT switch

⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of motor.

Ensure correct setting.

ROTATE MODE is set up with the RM SEL switch. Set this switch with power OFF.

- (1) Turn power [OFF].
- (2) Set the switch to the setting specified in the table "10-4. Applicable Motors."

RM SEL switch					
R4	R3	R2	R1		
0FF	0FF	0FF	0FF		
0FF	0FF	0FF	ON		
0FF	0FF	ON	0FF		
0FF	0FF	ON	ON		
0FF	ON	0FF	0FF		
0FF	ON	0FF	ON		
OFF ON		ON	0FF		
0FF	ON	ON	ON		
ON	0FF	0FF	0FF		
ON	0FF	0FF	ON		
ON	0FF	ON	0FF		
ON	0FF	ON	ON		
ON	ON	0FF	0FF		
ON	ON	0FF	ON		
ON	ON	ON	0FF		
ON	ON	ON	ON		

(Factory setting)

Sub adjustment(Not available)

#### 4-8. Setting of the EXTEND FUNCTION SELECT switch

#### ⚠ CAUTION

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of motor.

Ensure correct setting.

Set this switch with power OFF.

- (1) Turn power [OFF].
- (2) Set the functions required by the OP SEL switch.

OP SEL switch				Function allocation
P4	P3	P2	P1	Function allocation
0FF	0FF	0FF	0FF	-
0FF	0FF	0FF	ON	-
0FF	0FF	ON	0FF	_
0FF	0FF	ON	ON	-
0FF	ON	0FF	0FF	-
0FF	ON	0FF	ON	_
0FF	ON	ON	0FF	-
0FF	ON	ON	ON	-
ON	0FF	0FF	0FF	-
ON	0FF	0FF	ON	-
ON	0FF	ON	0FF	-
ON	0FF	ON	ON	-
ON	ON	0FF	0FF	-
ON	ON	0FF	ON	-
ON	ON	ON	0FF	_
ON	ON	ON	ON	Sub adjustment(Not available)

(Factory setting)

#### 5. Installation


#### 5-1. Conditions for Installation

Overheating may cause fire.

Mount it on a noncombustible member.

Keep it away from combustibles.

- (1) Designed for incorporating into equipment used indoors, this product requires to be installed in the following environment:
  - Indoors (where it is not exposed to direct sun).
  - •Where ambient temperature and humidity are controlled within the range set out in the specifications.
  - •Where there is no explosive, corrosive or inflammable gas.
  - •Where it can be protected from dust, salt or iron powder.
  - •Where the product is not exposed to direct vibration or shock.
  - •Where it is not exposed to splashes of water, oil or chemicals.
- (2) Install the driver at least 5mm away from other equipment. However, please be installed to a distance of at least 15mm from the heating element.

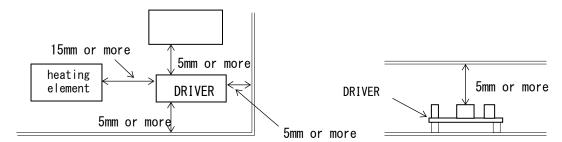

- Please contact us if you are not installed to a distance of at least 15mm from the heating element.
- (3) Take measures against accumulation of heat such as allowing generous space around the driver or installing a fan so that heat release is taken care of.
- (4) In the case that the overheat alarm signal is output, perform the cooling measure of compulsion air cooling etc. Use the driver on the condition that the overheat alarm signal is not output.
- (5) Do not allow standing or placing anything heavy on the product.


#### 5-2. Mounting Method


The holes for the fixing section on the product are used.

The following items are required:

● M-3 screw:		
● M-3 spring washer:	4	*1
• Spacer:	4	*1 *2


- \*1 Use the screw, the spring washer and the spacer are  $\phi$  6.5mm or less.
- \*2 Use the spacer 5mm or more in length.
- (1) Fix the product at the foure holes for the fixing section on the product.
  - ●The screw tightening torque value of 0.5N·m is recommended.
  - •Mounting example

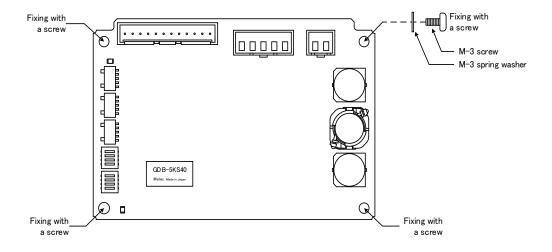

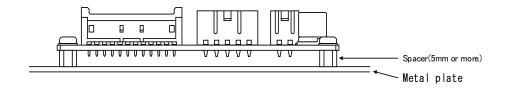

#### 6. Connection

#### 6-1. Overview of Connection Configuration

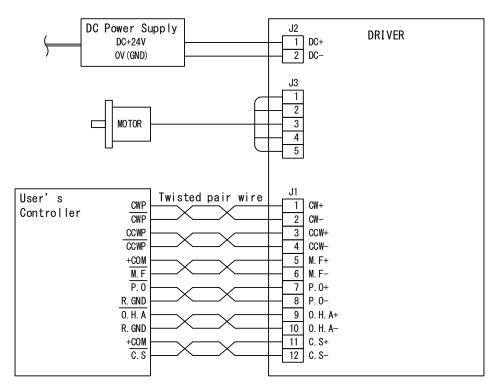



- Connect only one motor to one driver.
- •Use twisted pair wire for the CW/CCW input signal line.
- •Provide shielding for the signal line where considerable noise is generated.
- •Use the wire material of the characteristic that is difficult to burn.
- ●For the driver's power supply, use a DC power supply with reinforced insulation on its primary and secondary sides.

#### 6-2. Connecting Signal I/O Connector (J 1)

The following items are required:

- Housing for J1 (51103-1200 or 51163-1200:Molex)
   Contact for J1 (50351-8100:Molex)
   Manually operated crimping tool
   for AWG28-22 (57295-5000:Molex)
- (1) Crimp the contact to the cable used for wiring.
- (2) Insert the contact into the housing. Make sure that the housing No. and the connector No. on the product are matched before inserting the contacts.
- (3) Connect the housings to the connectors on the product.
  - The contacts for J1 are 12 pieces.
  - ■When inserting, keep pushing J1 housing into the connectors until it is locked. Also, check if the contacts are not displaced from the housing.
  - In wiring, isolate the J1 signal lines from equipment that may be a source of noise, the power line and the motor line.

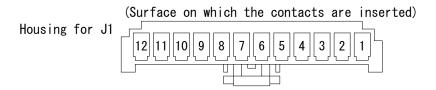

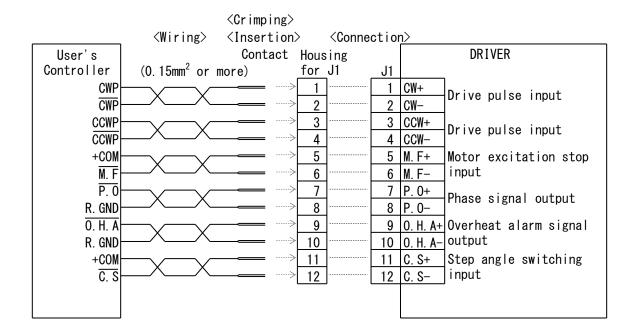

#### 6-3. Connecting DC Input/Motor Output Connector (J 2, J 3)

#### ♠ CAUTION


Erroneous connection may cause breakage of the motor or the driver. Correctly connect the DC Input/Motor output connector.

The following items are required:


Housing for J2 (51067-0200:Molex)
 Housing for J3 (51067-0500:Molex)
 Contact for J2, J3 (50217-9101:Molex)
 Manually operated crimping tool for AWG24-18 (57189-5000:Molex)


- (1) Crimp the contact to the cable used for wiring.
- (2) Insert the contact into the housing. Make sure that the housing No. and the connector No. on the product are matched before inserting the contacts.
- (3) Connect the housings to the connectors on the product.
  - The contacts for J2(for DC input) are 2 pieces, and for J3(motor output) are 5 pieces.
  - When inserting, keep pushing J2, J3 housings into the connectors until it is locked. Also, check if the contacts are not displaced from the housing.


(Surface on which the contacts are inserted)

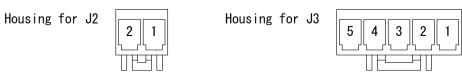

(DC input Connector)

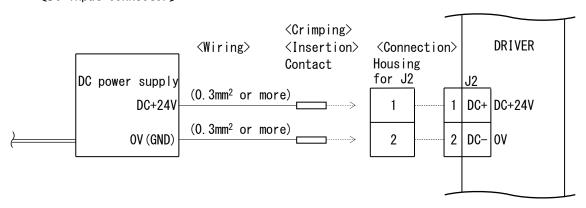

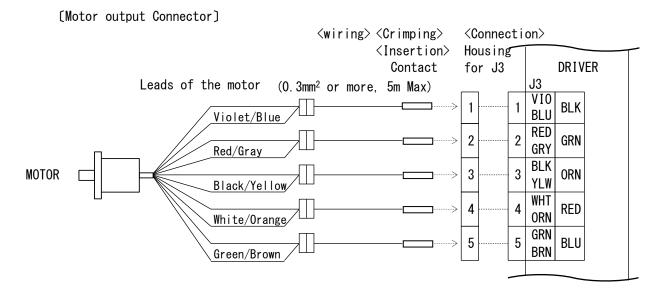

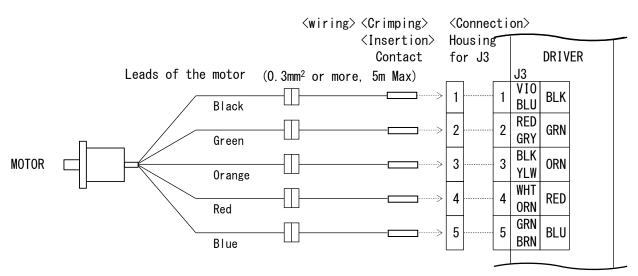


- ●The color indications for the motor crimping J3 represent color of the leads of the motor.
- •Use a cable of 5m or less for the motor cable.

#### 6-4. Inputting Power



Breakage of the machine or injury is apprehended due to unexpected behavior of the motor. Maintain the state where emergency stop is enabled at any time.

- (1) Input the DC power supply (DC+24V) in the cable that connected to No. 1 and No. 2 terminals of J2.
  - ① Timing chart

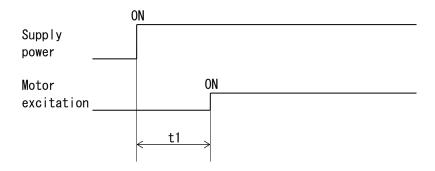

 $t1 \le 300ms$  (t1: Time required for the motor to be enabled.)

#### 7. Confirmation of Setting and Connection

#### 7-1. Check Points

This product requires different switch setting and motor wiring depending on the motor used.

Check if the switch setting and the motor wiring are correctly performed.

Check Points		Check	Remarks
Setting of MOTOR SELECT switch	MOTOR SEL (OFF)		
Setting of PULSE INPUT TYPE SELECT switch	SPI SEL (1P/2P)		
Setting of HOLD SWITCHING TIME SELECT switch	DHT SEL		
Setting of STEP TABLE switch	S. T SEL (S. T1/S. T2)		
Setting of STEP ANGLE SELECT switch	STEP SEL (switch No.)		
Setting of DRIVE CURRENT SELECT switch	DRIVE I.SEL (switch No.)		
Setting of HOLD CURRENT SELECT switch	HOLD I.SEL (switch No.)		
Setting of ROTATE MODE SELECT switch	RM SEL (R4 R3 R2 R1)		
Setting of EXTEND FUNCTION SELECT switch	0P SEL (P4 P3 P2 P1)		
Connection of J1	_		
Connection of J2	DC+, DC-		
Connection of J3	MOTOR		

#### 8. Maintenance and Check-up

#### 8-1. Maintenance and Check-up

Injury or fire is apprehended due to unexpected behavior.
Do not replace fuse.
Do not disassemble, repair or modify.

- (1) As for maintenance inspections the engineer of the specialty shall do it.
- (2) We recommend that the following check-ups should be performed periodically:
  - Checking for any loosened contact on the connectors.
  - Checking for any flaw and crack on the cabling.
- (3) In case of failure, return the driver to us and have it repaired.

#### 8-2. Troubleshooting

Trouble	Check Item	Assumed Cause
1. POWER LED does not come on.	<ul><li>Connection of power supply.</li><li>Value of power voltage.</li></ul>	<ul><li>Wiring error with power supply.</li><li>Power voltage failure.</li><li>Driver failure.</li></ul>
2. The motor is not excited.  (It can be easily rotated by hand.)	<ul> <li>Connection of the motor to the driver.</li> <li>ON/OFF status of the M.F signal.</li> <li>Value of the HOLD CURRENT SELECT switch.</li> </ul>	<ul> <li>Wiring error with the motor and the driver.</li> <li>The M.F signal is input.</li> <li>The setting for HOLD CURRENT is too low.</li> <li>Driver failure.</li> </ul>
3. The motor does not rotate. The motor behaves abnormally. The motor steps out.	<ul> <li>The same check items as those under item 2 above.</li> <li>Setting of the MOTOR SELECT switch.</li> <li>Setting of the PULSE INPUT TYPE SELECT switch.</li> <li>Connection of the pulse signal.</li> <li>Voltage and wave form of the pulse signal.</li> <li>Setting of the DRIVE CURRENT SELECT switch.</li> <li>Setting of the STEP ANGLE SELECT switch.</li> <li>ON/OFF status of the C.S signal.</li> <li>Setting of the ROTATE MODE SELECT switch.</li> <li>Setting of the EXTEND FUNCTION SELECT switch.</li> </ul>	<ul> <li>Wrong setting for the MOTOR selection.</li> <li>Wrong setting for the pulse input type.</li> <li>Wiring error with the pulse signal line.</li> <li>Pulse signal of wrong specifications.</li> <li>DRIVE CURRENT is too low.</li> <li>Wrong setting for the step angle.</li> <li>The C.S signal is input.</li> <li>Wrong setting for the ROTATE MODE selection.</li> <li>Wrong setting for the EXTEND FUNCTION selection.</li> <li>Driver failure.</li> <li>Motor failure.</li> </ul>

Trouble	Check Item	Assumed Cause
4. The motor steps out during acceleration.	<ul><li>Starting pulse speed.</li><li>Acceleration time.</li></ul>	<ul> <li>Starting pulse signal speed is too high.</li> <li>Acceleration time is too short.</li> </ul>
5. The motor generates excessive heat.	<ul> <li>Setting of the MOTOR SELECT switch.</li> <li>Setting of the DRIVE CURRENT SELECT switch.</li> <li>Value of the HOLD CURRENT SELECT switch.</li> </ul>	<ul> <li>Wrong setting for the MOTOR selection.</li> <li>DRIVE CURRENT is higher than the setting for the applicable motor.</li> <li>The setting for HOLD CURRENT is too high.</li> </ul>

Short-circuiting of the motor output connector may cause the driver to fail.

- ●The motor output connector and the power line.
- ●The motor output connector and the motor output connector.

When the failure phenomenon cannot be remedied, contact our office.

#### 9. Storing and Disposal

#### 9-1. Storing

- (1) Keep the product in the following environment:
  - ●Indoors (where it is not exposed to direct sun).
  - ■Where ambient temperature and humidity are controlled within the range set out in the specifications.
  - •Where there is no explosive, corrosive or inflammable gas.
  - •Where it can be protected from dust, salt or iron powder.
  - •Where the product is not exposed to direct vibration or shock.
  - •Where it is not exposed to splashes of water, oil or chemicals.
- (2) Do not allow standing or placing anything heavy on the product.

#### 9-2. Disposal

(1) Dispose of the product as industrial waste.

## 1 O. Specifications


#### 10-1. General Specifications

Supply Power	DC+24V *1 (Ripple voltage P-P 2.0V or less)  ● Rated input current: [DRIVE I.SEL ⇒ No.F set up] at DRIVE DC+24V: 2.0A *2  ● Rated input current: [HOLD I.SEL ⇒ Approx. 40% set up] at HOLD DC+24V: 0.4A	
Motor output current	●DRIVE CURRENT 0.30A/phase ~ 1.40A/phase ●HOLD CURRENT Approx. 40% of DRIVE CURRENT (factory-set)	
Input Signal	●Drive pulse input       (CW, CCW)       Photo-coupler input         ●Motor excitation stop input       (M. F)       Photo-coupler input         ●Step angle switch input       (C. S)       Photo-coupler input	
Output Signal	●Phase signal output         (P. 0)	
Functions of Operating Sections	●MOTOR selection (MOTOR SEL)  ●STEP TABLE selection (S. T SEL)  ●Step angle selection (STEP SEL)  ●HOLD CURRENT selection (HOLD I. SEL)  ●DRIVE CURRENT selection (DRIVE I. SEL)  ●PULSE INPUT TYPE selection (SPI SEL)  ●HOLD switching time selection (DHT SEL)  ●ROTATE MODE SELECT switch (RM SEL)  ●EXTEND FUNCTION SELECT switch (OP SEL)	
Operating Ambient Temperature	0°C ∼ +50°C (No freezing allowed.)	
Operating Ambient Humidity	80%RH or less (No condensation allowed.)	
Storing Temperature	-10°C ∼ +60°C (No freezing allowed.)	
Storing Humidity	80%RH or less (No condensation allowed.)	
Altitude	Up to 1000m above sea level	
Atmosphere	Indoor (Exposure to direct sun is not allowed.) Without any explosive, corrosive or inflammable gas, oil mist, or dust.	
Withstanding Vibration	No abnormality should be found after a vibration test at 10~55Hz, 0.15mm P-P	
Insulation resistance	DC connector - signal connector DC500V 100MΩ or more	
Exterior Dimensions	$^{\text{W}}91 \times ^{\text{H}}61.5 \times ^{\text{D}}16 \text{ (mm)}$	
Weight	0. 04 kg	

- \*1 Input voltage range is DC+24V $\pm$ 10%.
- \*2 Use a power supply that provides sufficient input current.

#### 10-2. I/O Signal


#### (1) Example Circuit Connection

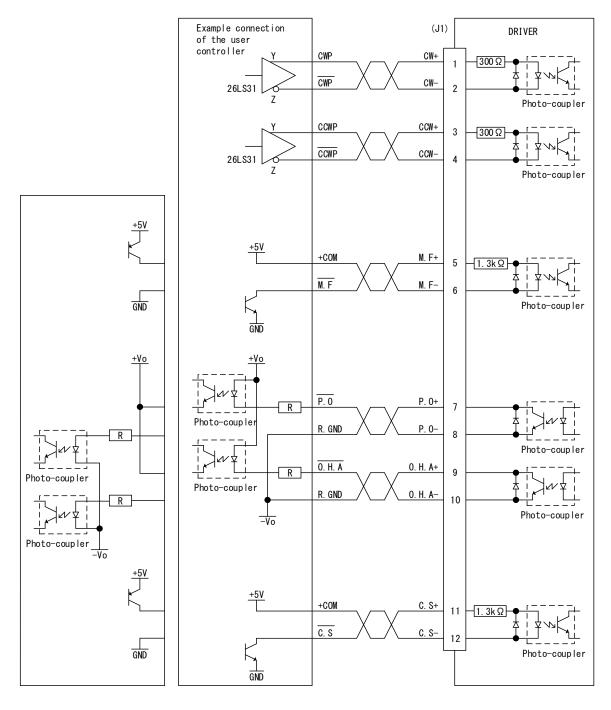


- (2) Drive pulse input (CW, CCW)
  - ① Operating current range :  $5mA \sim 14mA$  The photo-coupler turns on with inter-terminal voltage of 3.1V $\sim$ 5.5V. (Photo-coupler diode  $V_F \rightleftharpoons 1.5V$ )
- $\begin{array}{c|cccc} \text{CW+} & & & & & \\ \text{CW-} & & & & & \\ \text{CW-} & & & & & \\ \text{CCW-} & & & & & \\ \text{CCW-} & & & & & \\ & & & & & \\ & & & & & \\ & & & & & \\ & & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & \\ & & & \\ & & & \\ & & & \\ & & & \\ & & & \\ & & & \\ & & \\ & & & \\ & \\ & & \\ & \\ & & \\ & \\ & \\ & & \\ & \\ & & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ &$

[To the line driver 26LS31]


→ CW+ (CCW+)

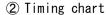

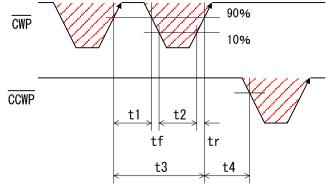


1/	t1. t2. tf. tr. t3. t4	Maximum response frequency
Divisions	21, 22, 21, 21, 22, 21	(at 50% duty)
1/1, 1/2	$t1 \ge 5 \mu s$ , $t2 \ge 5 \mu s$ , $tf$ , $tr \le 1 \mu s$ , $t3 \ge 10 \mu s$ , $t4 > 10 \mu s$	100kHz
Other setting	$t1 \ge 0.5 \mu \text{ s}, t2 \ge 0.5 \mu \text{ s}, tf, tr \le 1 \mu \text{ s}, t3 \ge 1 \mu \text{ s}, t4 > 1 \mu \text{ s}$	1MHz

- The shaded area ( '//) indicates light emission from the photo-coupler, and the motor is driven at the rising edge (?).
  "t4" greatly varies according to the inertial moment including that of the motor.
- 3 Automatic switching for DRIVE/HOLD

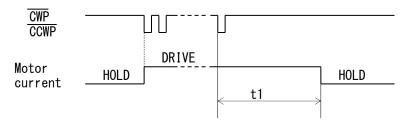

t1 $\doteqdot$  16ms (HOLD SWITCHING TIME SELECT switch : ON ) t1 $\doteqdot$ 150ms (HOLD SWITCHING TIME SELECT switch : OFF)

- Inputting drive pulse causes the current output to the motor to change from HOLD CURRENT to DRIVE CURRENT, which returns to HOLD CURRENT in about "t1". DRIVE CURRENT continues if pulse is input on driving-state.
- 4 Direction of rotation

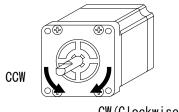

CW(Clockwise)


(3) Motor excitation stop input (M.F)

## ♠ CAUTION


Deterioration of the holding power with the motor may cause breakage of the machine or injury.

Check safety before inputting.

① Operating current range : 2.6mA $\sim$ 19.5mA The photo-coupler turns on with inter-terminal voltage of 4.5 V $\sim$ 26.4 V. (Photo-coupler diode V<sub>F</sub> $\rightleftharpoons$  1.1 V)

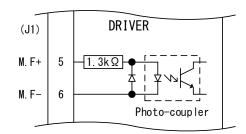


- Motor output current is shut off with the photo-coupler ON. At this time, motor torque changes to detent torque.
- When this signal is input, motor torque may be lost, resulting in failure to retain the load transported.
  In particular, this risk is high with the vertical drive (such as the Z-axis).
- 2 Timing chart

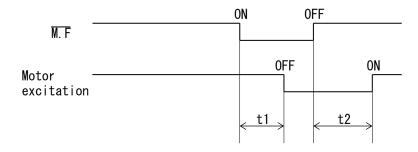

t1≤5ms (t1: Time required for the motor output current to be shut off.)

t2≤100ms (t2: Time required for the motor to be enabled.)

- (4) Phase signal output (P.0)
  - ① Output current a. Ic  $\leq$  6mA, VcE < 2V b. Ic  $\leq$  2mA, VcE (sat) < 0. 6V VcE0  $\leq$  30V

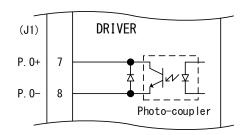


80 pulses 160 pulses 800 pulses 1600 pulses

- In case of the excitation home position, the signal is output. (photo-coupler ON)
- In case of simultaneously using P.O signal and C.S signal, input C.S signal while P.O signal is being output to switch the step angle. Otherwise, P.O signal may not be output.

#### 2 Timing chart

 $\bullet$  P. O output timing (for 1/1 STEP)

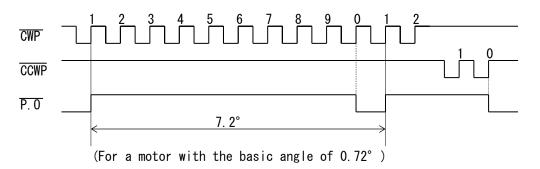

#### ● P. O output time

1/1 STEP:	once	in	10	pulses	1/8 STEP: once i
1/2 STEP:	once	in	20	pulses	1/16 STEP: once i
1/4 STEP:	once	in	40	pulses	1/80 STEP: once i
1/10 STEP:	once	in	100	pulses	1/160 STEP: once i
1/20 STEP:	once	in	200	pulses	
1/40 STEP:	once	in	400	pulses	
1/100 STEP:	once	in	1000	pulses	
1/200 STEP:	once	in	2000	pulses	
1/400 STEP:	once	in	4000	pulses	
1/800 STEP:	once	in	8000	pulses	
1/1000 STEP:	once	in	10000	pulses	
1/2000 STEP:	once	in	20000	pulses	
1/4000 STEP:	once	in	40000	pulses	
1/8000 STEP:	once	in	80000	pulses	

(5) Overheat alarm signal output and overheat alarm LED (0.H.A)


Overheating may cause fire.

Stop operation upon output of this signal.

⚠ WARNING


Overheating may cause fire. Stop operation when this LED comes on.

① Output current a.  $Ic \le 6mA$ , VcE < 2V b.  $Ic \le 2mA$ , VcE (sat) < 0.6V  $VcE 0 \le 30V$ 

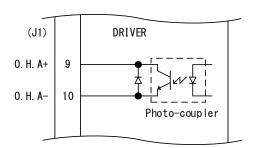

- Use overheat alarm signal output (0.H.A) without fail.
- In case of internal temperature of the driver reaches approx. 70°C or more, the signal is output(photo-coupler ON) and O. H. A LED comes on. At this time the motor output current is not blocked.
- When this signal is output, stop operation and check if there is any abnormality occurring with the motor and the driver.
- Provide mechanical cooling, for example, if this signal is output while no abnormality is detected.
- Continuous operation is possible unless this signal is output.


- (6) Step angle switch input (C.S)
- ① Operating current range : 2.6mA  $\sim$  19.5mA The photo-coupler turns on with inter-terminal voltage of 4.5 V  $\sim$  26.4 V. (Photo-coupler diode V<sub>F</sub> $\rightleftharpoons$  1.1 V)

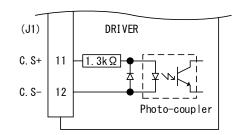

Step angle division is switched to 20 divisions of the basic angle with the photo-coupler ON.

The setting for the STEP ANGLE SELECT switch is ignored.

- ●When the step angle is set 1000, 2000, 4000 or 8000 divisions of the basic angle, change of the excitation position may be caused by inputting C.S signal.
- 2 Timing chart

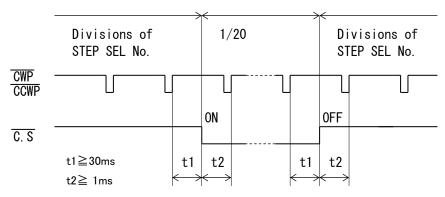

- Switching the step angle by the C.S signal requires time "t1" and "t2" before and after inputting drive pulse.
- 3 STEP ANGLE SELECT switch and C.S signal


(STEP ANGLE SELECT switch)


S.T SEL switch (OFF: S.T1)						
STEP SEL		step angle(°)				
No.	Divisions	0.72° motor				
0	1/1	0. 72				
1	1/2	0. 36				
2	1/4	0. 18				
3	1/8	0. 09				
4	1/10	0. 072				
5	1/20	0. 036				
6	1/40	0. 018				
7	1/80	0. 009				
8	1/100	0. 0072				
9	1/200	0. 0036				
Α	1/400	0. 0018				
В	1/800	0. 0009				
С	1/1000	0. 00072				
D	1/2000	0. 00036				
E	1/4000	0. 00018				
F	1/8000	0. 00009				

			1
S. T SE	L switch	(ON : S. T2)	
STEP SEL	1/	step angle(°)	
No.	Divisions	0.72° motor	
0	1/1	0. 72	
1	1/2	0. 36	
2	1/4	0. 18	
3	1/8	0. 09	
4	1/10	0. 072	(When the C.S
5	1/20	0. 036	_∧ signal is input
6	1/40	0. 018	$  \Box \rangle$
7	1/80	0.009	<sup>□</sup> 1/20
8	1/100	0. 0072	(0. 036°)
9	1/200	0. 0036	
Α	1/400	0. 0018	
В	1/800	0. 0009	
С	1/1000	0. 00072	
D	1/2000	0. 00036	
Е	1/16	0. 045	
F	1/160	0.0045	

### 10-3. Dimensions

(Unit:mm)

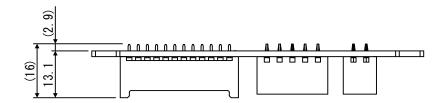

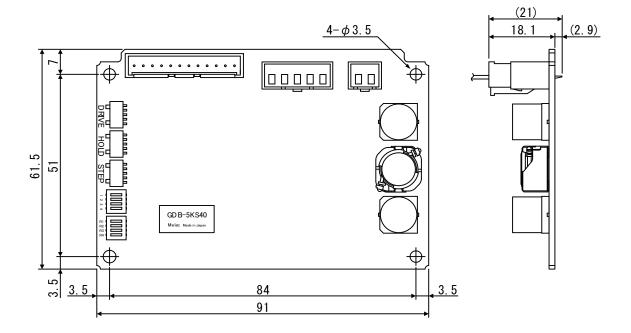

## 1 O - 4. Applicable Motors

- (1) GDB-5KS40 can drive a 5-phase stepping motor with 0.35A/phase  $\sim$  1.4A/phase.
  - ① Examples of applicable motors

SANYO DENKI Co., LTD.		Current (A/phase)	Setting DRIVE I.SEL switch No.	Setting MOTOR SEL switch	Setti s 4 3	vitch	SEL 1	Torque Data Fig. No.
□28mm	SH5281-3241 SH5281-7241 (7211) (SH5281-7411) SH5285-7241 (7211) (SH5285-7411)	0. 35 0. 75 0. 75 0. 75 0. 75	2 8 8 8 8	OFF OFF OFF OFF	OFF OF OFF OF OFF OF OFF OF	F OFF	ON ON ON ON	Fig. 1 - Fig. 2 - Fig. 3
	103F5505-7241 (7211) 103F5508-7241 (7211) 103F5510-7241 (7211) 103F7852-8241 (8211) 103F7853-8241 (8211)	0. 75 0. 75 0. 75 1. 4 1. 4	8 8 8 F F	OFF OFF OFF OFF	OFF OF OFF OFF OFF OFF	F ON F ON	OFF OFF OFF	- Fig. 4 - Fig. 5

ORIENTAL MOTOR Co., Ltd.		Current (A/phase)	Setting DRIVE I.SEL switch No.	Setting MOTOR SEL switch	Set		RM : tch 2	SEL 1	Torque Data Fig. No.
□28mm	PK523PA (B)	0. 35	2	0FF	0FF	0FF	0FF	ON	Fig. 6
	PKP523N12A (B)	1. 2	D	0FF	0FF	0FF	0FF	ON	Fig. 7
	PK525PA (B)	0. 35	2	0FF	0FF	0FF	0FF	ON	_
	PKP525N12A (B)	1. 2	D	0FF	0FF	0FF	0FF	ON	-
□42mm	PK543-A (B)	0. 75	8	0FF	0FF	0FF	ON	0FF	Fig. 8
	PK544-A (B)	0. 75	8	0FF	0FF	0FF	ON	0FF	_
	PK545-A (B)	0. 75	8	0FF	0FF	0FF	ON	0FF	-
□60mm	PK564H-A (B)	1. 4	F	0FF	0FF	0FF	ON	ON	-
	PK564-A (B)	0. 75	8	0FF	0FF	ON	0FF	0FF	_
	PK566-A (B)	0. 75	8	0FF	0FF	ON	0FF	0FF	_
	PK566H-A (B)	1.4	F	0FF	0FF	ON	0FF	0FF	Fig.9
	PK569-A (B)	1. 4	F	0FF	0FF	ON	0FF	0FF	_
Factory Setting			F	0FF	0FF	0FF	0FF	0FF	_

( ) : Both axes

•Please contact us if you want to use the motor other than the above to our office.

### 10-5. Torque Characteristics

(1) Representations in the torque characteristics table are made in terms of the motor rotation ( $s^{-1}$ ) vs. torque ( $N \cdot m$ ).

Motor rotation (s<sup>-1</sup>) and drive pulse frequency (Hz) are converted as follows:

Motor rotation(s<sup>-1</sup>) 
$$\times \frac{360^{\circ}}{\text{Step angle}} = \text{Drive pulse input frequency(Hz)}$$

Motor rotation  $(s^{-1})$  and motor rotation (r/min) are converted as follows:


Motor rotation(
$$s^{-1}$$
) × 60 = Motor rotation( $r/min$ )

- $\bullet$  Use the Motor rotation at  $100s^{-1}$  (6000r/min) or less.
- (2) The Maximum Starting Pulse Rate is represented as "fs" by the value at zero inertial load.
- (3) Upon operation, provide adequate allowance for torque.
- (4) The stepping motor may attain high temperature, depending on the operational conditions.

Use the stepping motor according to the Instructions Manual produced by motormakers.

Fig. 1 GDB-5KS40 SH5281-3241 0. 35A/PHASE

DRIVE I. SEL = No2
MOTOR SEL = OFF
RM1, RM2, RM3, RM4 = ON, OFF, OFF, OFF

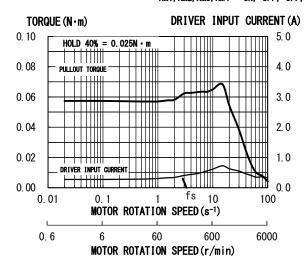


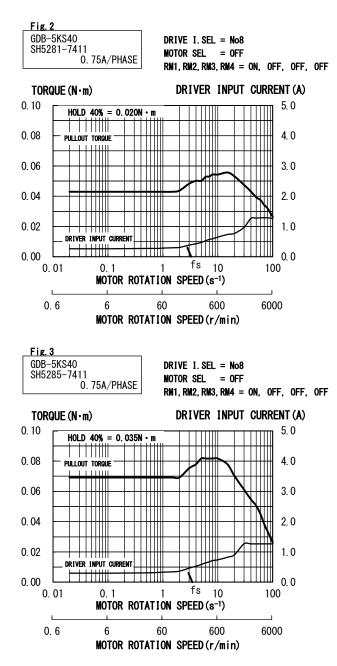


Fig. 4 GDB-5KS40 103F5508-7241 (7211) 0. 75A/PHASE

DRIVE I. SEL = No8 MOTOR SEL = OFF RM1, RM2, RM3, RM4 = OFF, ON, OFF, OFF

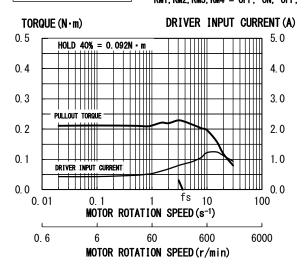

GDB-5KS40 103F7852-8241 (8211) 1. 4A/PHASE

DRIVE I.SEL = NoF MOTOR SEL = OFF RM1, RM2, RM3, RM4 = OFF, OFF, ON, OFF

DRIVER INPUT CURRENT (A) TORQUE (N·m) 2.0 5.0 HOLD 40% = 0.41N - m - PULLOUT TORQUE 1.6 4.0 3.0 1.2 DRIVER INPUT CURRENT: 0.8 2.0 0.4 1.0 0.0 0.0 0. 1 1 fs 10 MOTOR ROTATION SPEED (s-1) 0.01 100 60 600 6000 0.6 6 MOTOR ROTATION SPEED (r/min)

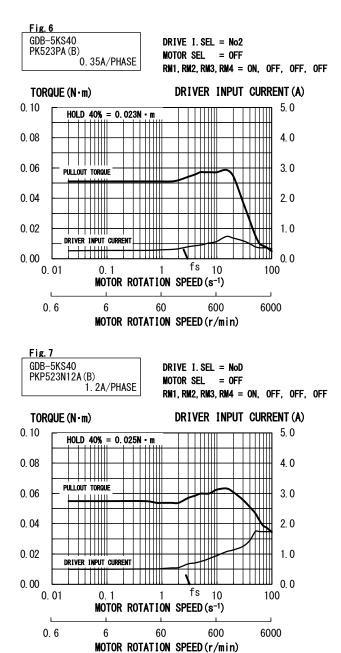


Fig. 8 GDB-5KS40 PK543-A(B) 0. 75A/PHASE

DRIVE I. SEL = No8 MOTOR SEL = OFF RM1, RM2, RM3, RM4 = OFF, ON, OFF, OFF


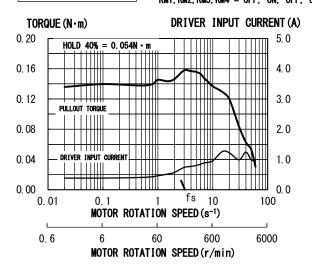


Fig. 9 GDB-5KS40 PK566H-A (B) 1. 4A/PHASE

DRIVE I.SEL = NOF MOTOR SEL = OFF RM1, RM2, RM3, RM4 = OFF, OFF, ON, OFF

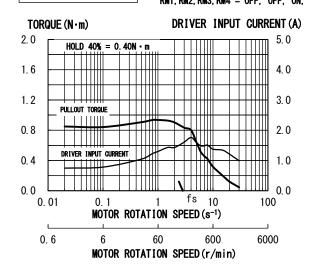

#### 10-6. Conforming to Europe standards

#### (1) Low voltage directive

This product is not subject to the EC's Low Voltage Directive by the following.

- This product should be installed within an enclosure.
- For the driver's power supply, use a DC power supply with reinforced insulation on its primary and secondary sides.

#### (2) EMC directive

This product declares the CE marking based on the EMC Directive by oneself.

Applicable Standards


EN61000-6-4

EN61000-6-2

- This product conducted EMC measurement with the system configuration for EMC.
  - EMC characteristic may vary depending on the configuration of the equipment that contains the driver or stepping motor. Be sure to conduct EMC measurement with the product assembled in your equipment.

#### Configuration

The metallic enclosure and shielded wires and ferrite core work to shield noise.

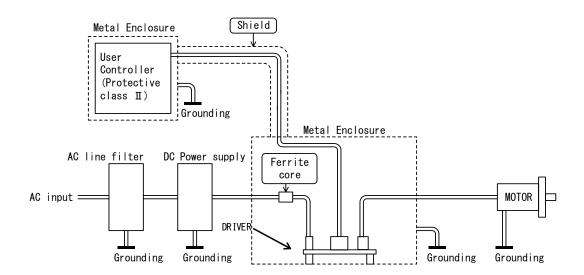

### (3) RoHS directive

This product dose not contain the substrances exceeding the restriction values.

The main parts which revised by this manual

Parts	Content

### Technical Service Sales and Service

TEL. (042) 664-5384 FAX. (042) 666-2031 E-mail s-support@melec-inc.com

### Melec Inc.

516-10, Higashiasakawa-cho, Hachioji-shi, Tokyo 193-0834, Japan www.melec-inc.com